

## Peel-Off (Self-Strip) Kit Installation Instructions


Use these instructions to install and configure the Peel-Off (Self-Strip) Kit for the EasyCoder® PM4i Bar Code Label Printer. The Peel-off kit allows the printer to automatically separate self-adhesive labels from the liner immediately after printing.




**Note:** If the kit comes factory installed, you only need to route your media, and configure the Label Taken Sensor.

### To install the Peel-Off Kit


- 1 Open the side door and remove front door by pressing down on the two tabs that secure the front door to the printer.

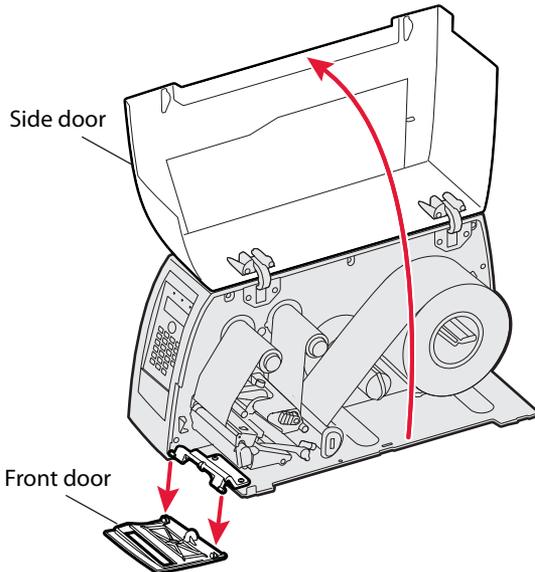


- 2 Attach the Peel-off kit to the printer by snapping it on the two hinge pins that held the front door. Note that you may have to slide the kit in at an angle.

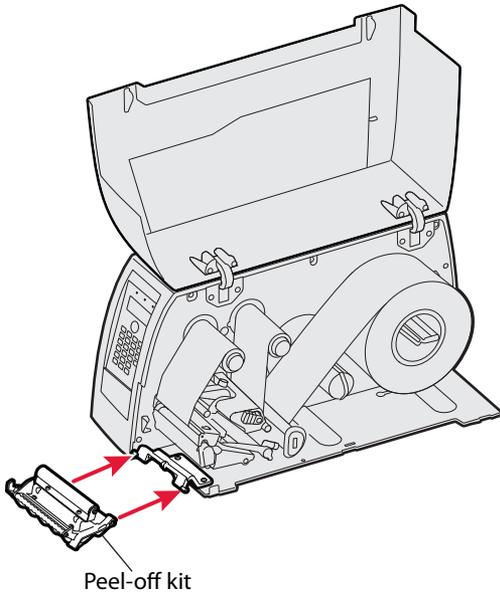

- 3 Route the media for Peel-Off mode by raising the printhead and routing the media as shown in the illustration below.

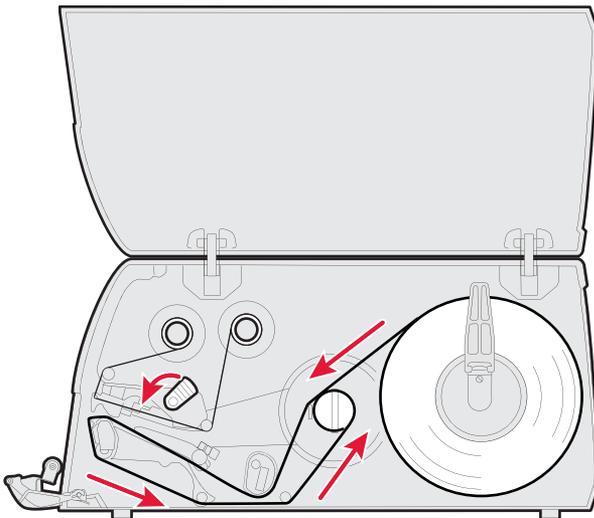

- 4 Close the side door and raise the Peel-off kit by the handle.

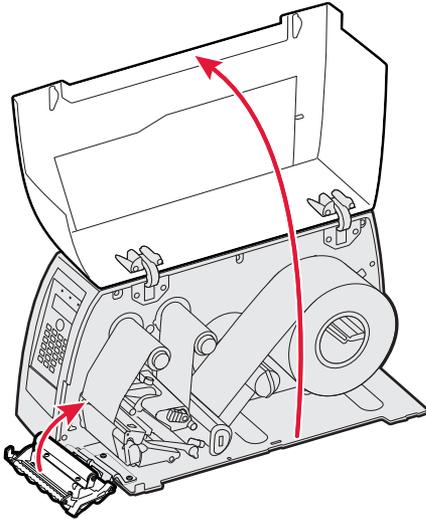

- 5 Adjust the Label Taken Sensor (LTS) so that the media feeds correctly.

If you are using Fingerprint:

- a Press the **Setup** key to enter the Setup menu.

```
SETUP :  
SER-COM, UART1
```

- b Use the **Right** arrow key to browse the Setup menu. Once you get to the Print Defs screen, press the **Enter** key to enter the Print Defs screen.
- c Press the **Right Arrow** key until you get to the LTS screen and press the **Enter** key to enter the LTS Adjust screen.

```
PRINT DEFS :  
LTS ADJUST
```

- d Press the **Enter** key to self-calibrate the LTS.
- e Wait for the prompt to remove your test label, then remove the label. After the label has been removed, press the **Enter** key.
- f Your printer is configured for Peel-Off mode. Press the **Setup** key to exit the Setup menu.

---

If you are using IPL:

- a Press the **Setup** key to enter the Setup menu.
- b Use the **Right** arrow key to browse the Setup menu. Once you get to the Configuration screen, press the **Enter** key to enter the Configuration screen.
- c Press the **Right Arrow** key until you get to the LTS Calibration screen and press the **Enter** key to enter the LTS Calibration screen.

LTS CALIBRATION:  
LTS CALIBRATION

- d Press the **Enter** key to self-calibrate the LTS.
- e Wait for the prompt to remove your test label, then remove the label. After the label has been removed, press the **Enter** key.
- f Your printer is configured for Peel-Off mode. Press the **Setup** key to exit the Setup menu.



Worldwide Headquarters  
6001 36th Avenue West  
Everett, Washington 98203  
U.S.A.

tel 425.348.2600

fax 425.355.9551

[www.intermec.com](http://www.intermec.com)

© 2008 Intermec Technologies  
Corporation. All rights reserved.

PM4i Bar Code Label Printer Peel-Off (Self-Strip) Installation Instructions



P/N 943-198-001